


PARTIAL PIER 2 REPAIR PLAN  
SCALE: 3/16" = 1'-0"

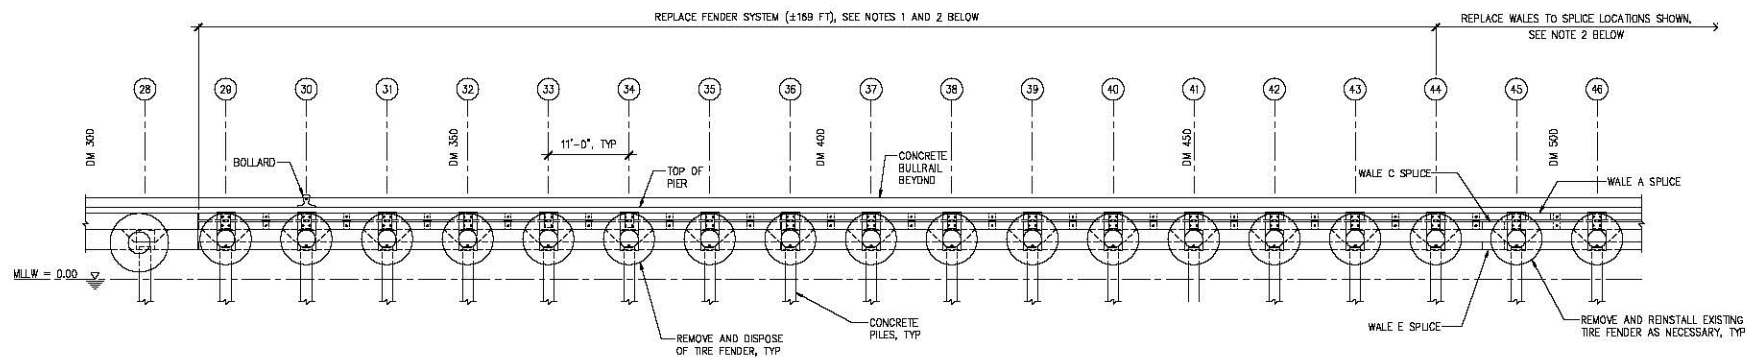

PARTIAL PIER 2 REPAIR ELEVATION  
SCALE: 3/16" = 1'-0"

NOTES:

1. FENDER REPLACEMENT SHALL INCLUDE REPLACING ALL TIMBER MEMBERS AND HARDWARE. TIMBER MEMBERS INCLUDING WALES, CHAFING STRIPS, RUBBING BLOCKS AND BLOCKING. HARDWARE SHALL INCLUDE CHAINS, SHACKLES, EYE BOLTS UNLESS NOTED OTHERWISE.
2. WALES SHALL BE REPLACED TO APPROXIMATE SPLICE LOCATIONS SHOWN. CONTRACTOR TO FIELD VERIFY SPLICE LOCATIONS. MINIMUM EXISTING AND NEW WALE LENGTHS SHALL BE 16'-0" AND SPAN AT LEAST 1 BAY. CONTRACTOR SHALL STAGGER SPLICES SUCH THAT NO MORE THAN ONE TOP AND ONE BOTTOM WALE SPLICE ARE LOCATED IN THE SAME BAY.
3. FENDER CHAINS, GROMMETS AND SHACKLES NOT SHOWN FOR CLARITY.

	5/23/23		ADDENDUM NO. 1	MAKE
	DATE	DESCRIPTION	BY	APPROVED
	STATE OF HAWAII DEPARTMENT OF TRANSPORTATION HARBORS DIVISION			
	JOB TITLE FENDER REPAIRS AT PIER 1, 2 AND TUG PIER KAHULUI HARBOR, MAUI, HAWAII			
SHEET TITLE PARTIAL PIER 2 REPAIR PLAN AND ELEVATION				
DESIGNED BY: GO DRAWN BY: DL CHECKED BY: GM DATE: 04/20/23 SCALE: AS SHOWN	JOB NUMBER S30215		7 of 13 SHEETS	