
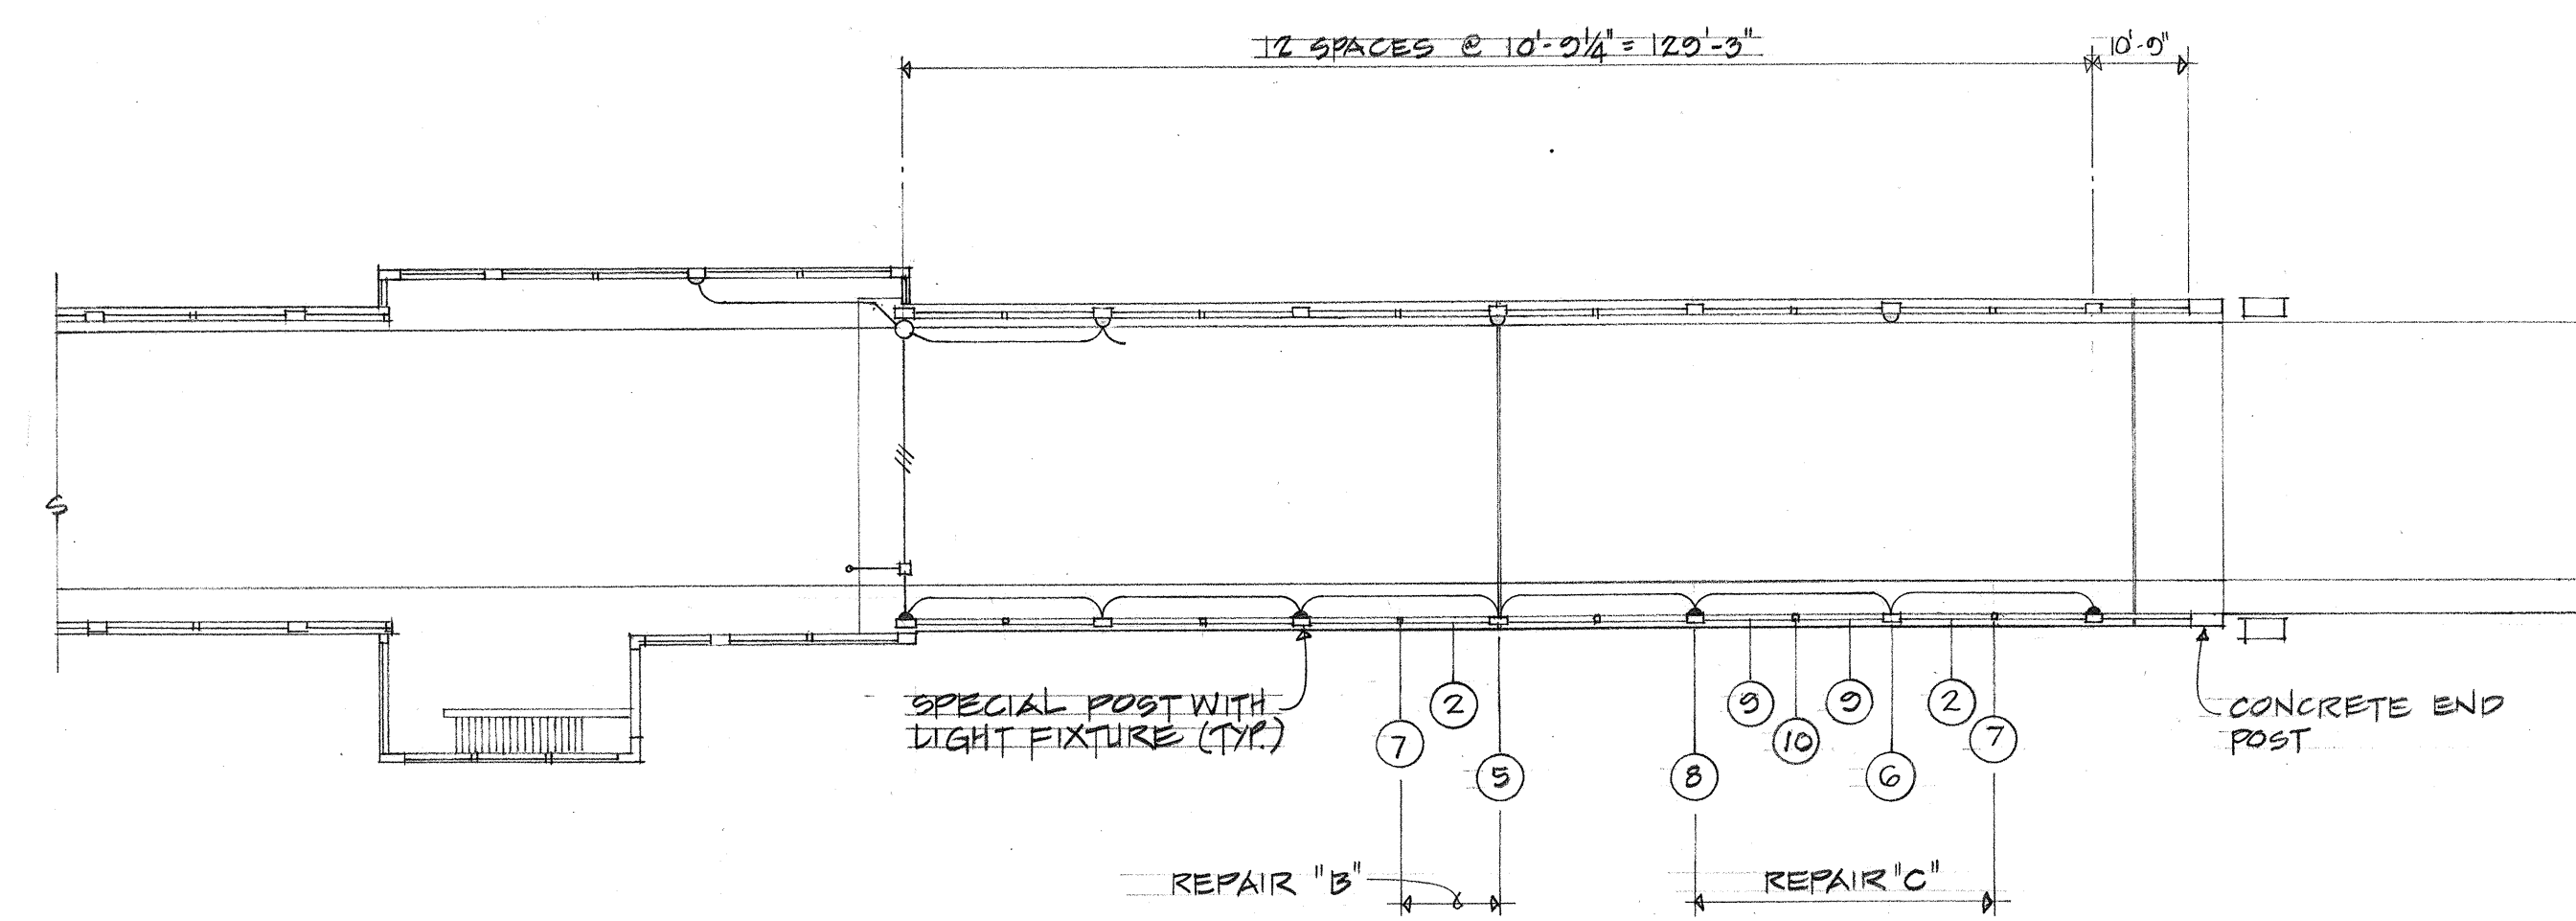
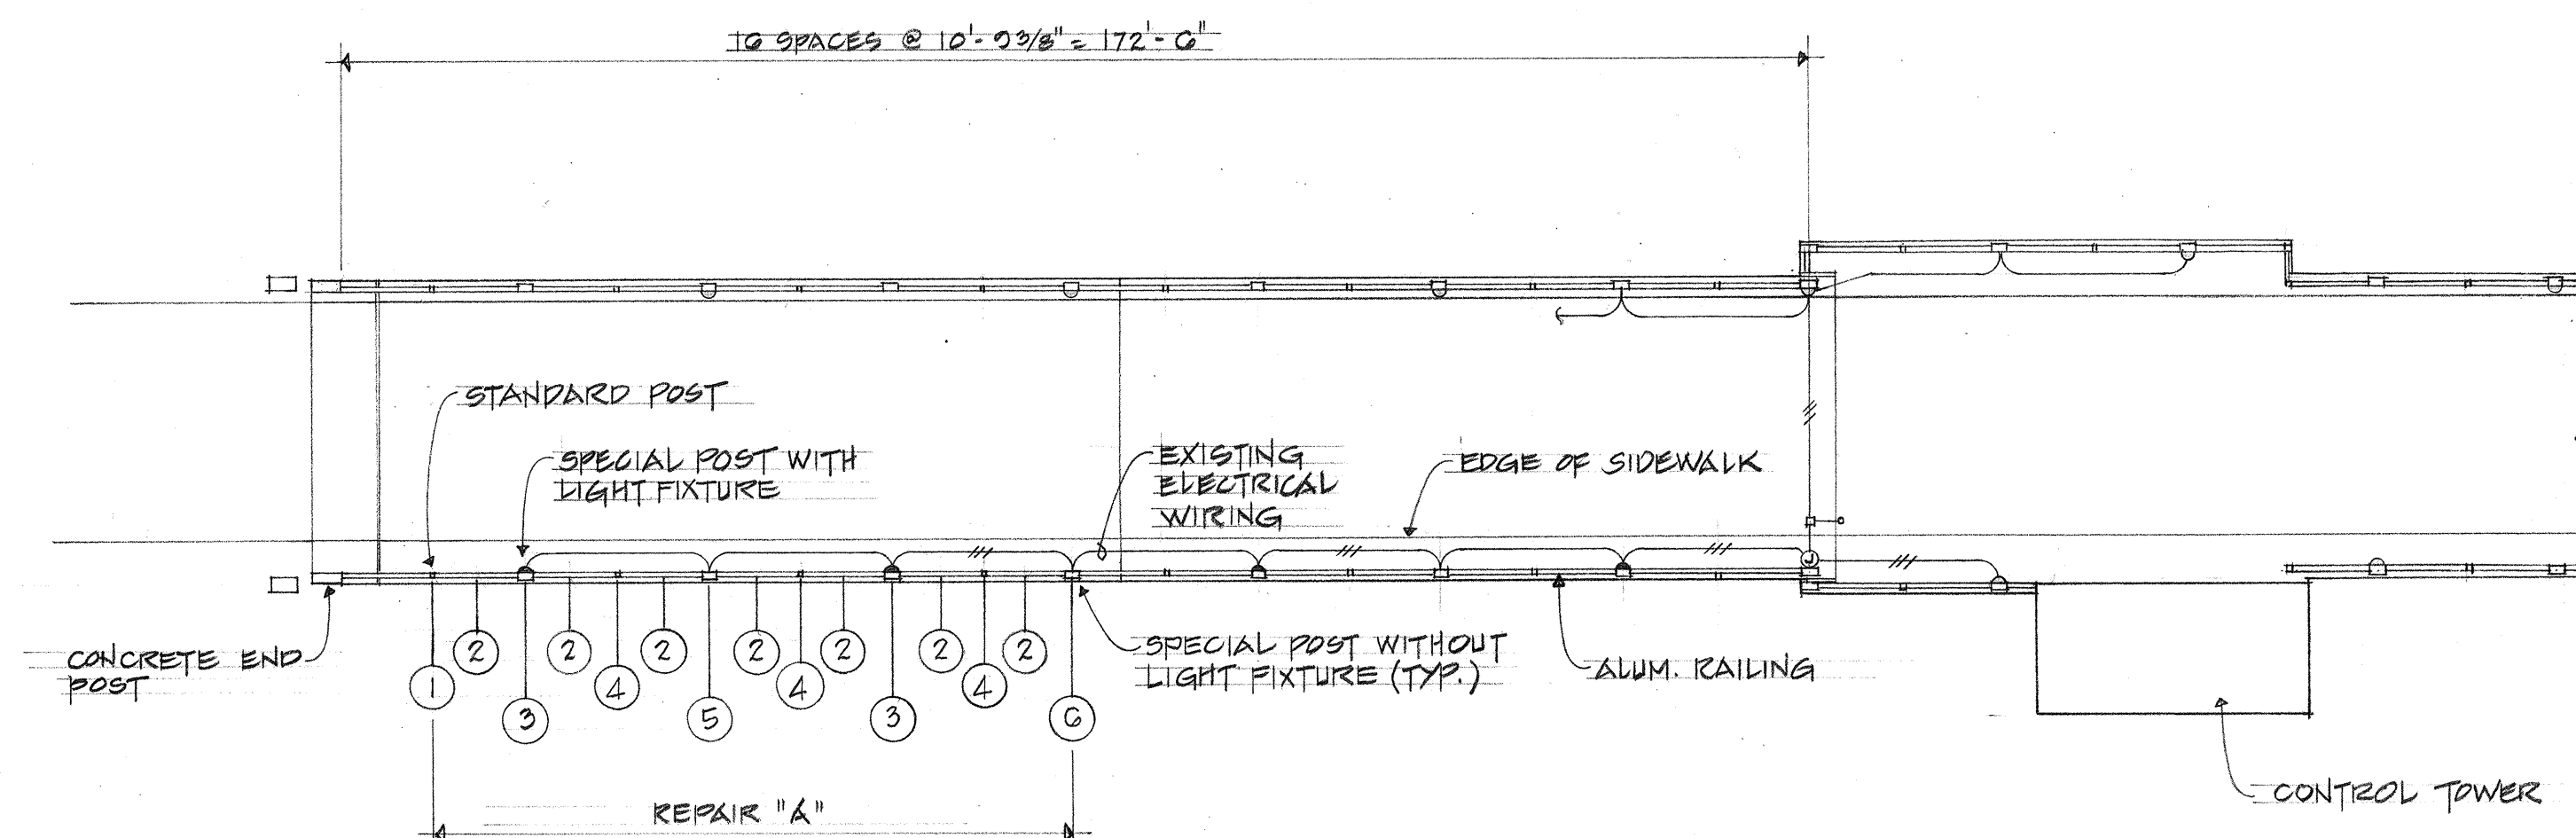
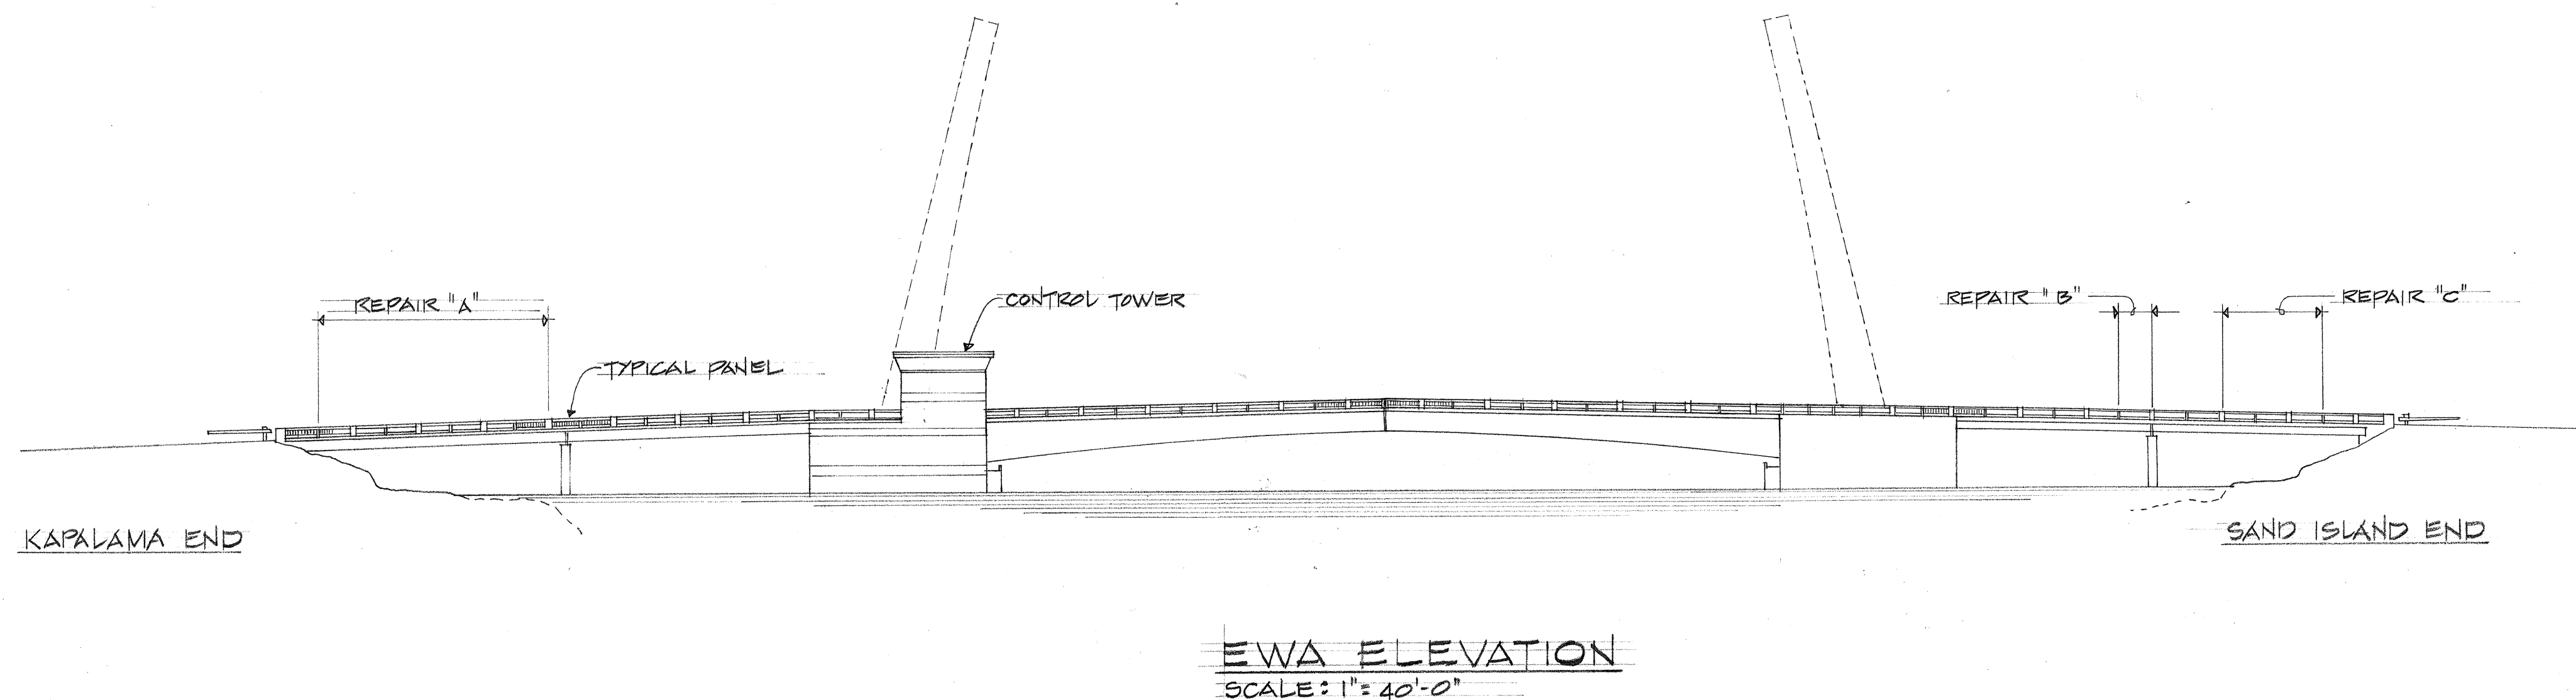


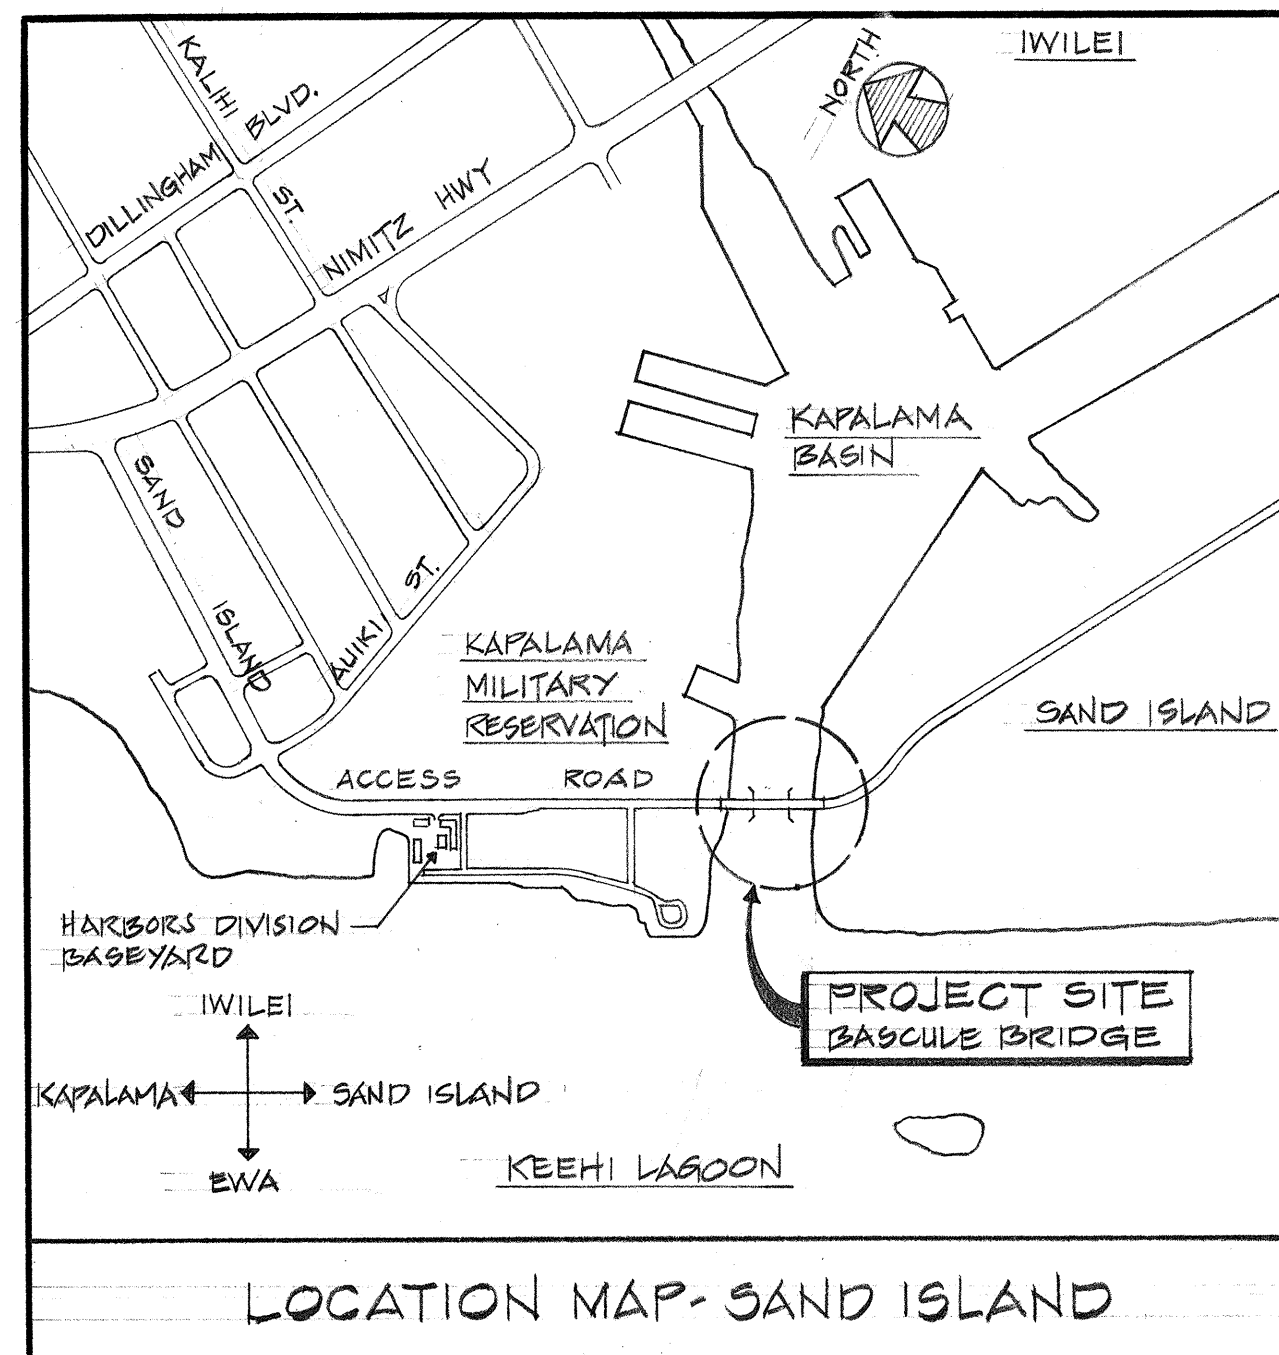

REPAIR SCHEDULE

REPAIR NUMBER	REPAIR DESCRIPTION	DETAIL NUMBER	REPAIR NUMBER	REPAIR DESCRIPTION	DETAIL NUMBER
1	REPLACE BOTTOM ANGLE CLIP, FLAT WASHERS AT POST BASE, SADDLE, CAP AND HARDWARE.	A 3	7	REMOVE DAMAGED BOTTOM ANGLE CLIP AT EXISTING STANDARD POST AND INSTALL NEW ANGLE CLIP	B 3
2	RAILING MISSING. INSTALL NEW RAILING	A 2	8	BOTTOM ANGLE BENT AT EXISTING SPECIAL POST. REMOVE BENT ANGLE AND WELD NEW 6x4x3/8x2 3/8 ANGLE.	D 2
3	REMOVE DAMAGED ANCHOR BOLTS (4) AND INSTALL 4 NEW ANCHOR BOLTS	C 2	9	RAILING DAMAGED, REMOVE AND INSTALL NEW RAILING	A 2
	INSTALL NEW SPECIAL POST WITH LIGHT FIXTURE AND CONNECT EXISTING ELECTRICAL WIRING	D 2	10	REMOVE DAMAGED ANCHOR BOLTS (4) AND INSTALL 4 NEW ANCHOR BOLTS AND NEW STANDARD POST.	C 2
	REMOVE DAMAGED ANCHOR BOLTS (4) AND INSTALL 4 NEW ANCHOR BOLTS	C 2			
4	INSTALL NEW STANDARD POST	A 2			
	REMOVE DAMAGED ANCHOR BOLTS (4) AND INSTALL 4 NEW ANCHOR BOLTS	C 2			
5	INSTALL NEW SPECIAL POST WITHOUT LIGHT FIXTURE AND CONNECT EXISTING ELECTRICAL WIRING	D 2			
6	BOTTOM ANGLE CLIP AT EXISTING SPECIAL POST MISSING. WELD NEW 6x4x3/8x2 3/8 ANGLE CLIP.	D 2			

SUBMITTED BY: <i>Richard H. Esalu</i>		RECOMMENDED BY: <i>Gary Chiu</i> ASSISTANT CHIEF OF HARBORS FOR ENGINEERING	
REV	DATE	DESCRIPTION	BY
STATE OF HAWAII DEPARTMENT OF TRANSPORTATION HARBORS DIVISION			
JOB TITLE REPAIRS TO RAILINGS AT BASCULE BRIDGE HONOLULU, HAWAII			
SHEET TITLE BRIDGE PLANS & REPAIR SCHEDULE			
DESIGNED BY: RK	APPROVED BY: <i>Gary Chiu</i> 9/19/75	SHEET 1	
DRAWN BY: RD	FOR CHIEF, HARBORS DIVISION	H.C. 1263	
CHECKED BY: RK	JOB NUMBER	OF 3 SHEETS	
DATE: JULY 1975			
SCALE: AS SHOWN			