


Existing bar

Added bar ~ (Round bar same size as square bar)



SHOWING VARIOUS TYPES OF REPAIRS AND LIMITS OF MEASUREMENT FOR PAYMENT

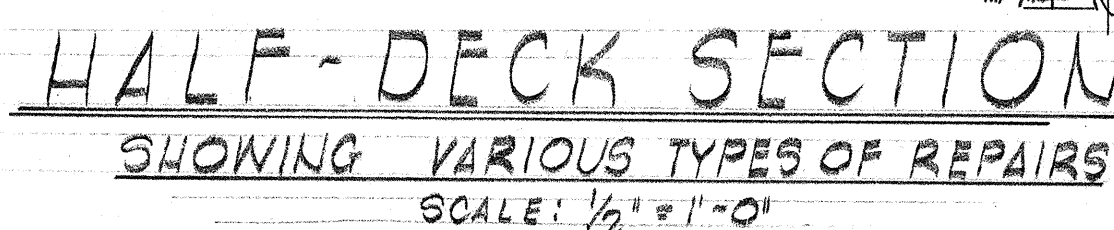

- Existing ground line shall be excavated to get an approximate distance of 'G'-0" from the bottom side to be repaired with pneumatic mortar.

- A lesser distance will be allowed if the contractor can adequately place the mortar to the satisfaction of the Engineer.

- 1- Repairs to the under side of slab shall be made in sections and sequences as shown on Reflected Ceiling Plan.
- 2- Payment for repairs by square feet shall be measured by the average width and length as shown on the details.
- 3- Reinforcing bars that are rusted more than 50% of their original area shall be strengthened as shown on Splice Detail.
- 4- All deteriorated, damaged, cracked, spalled, honeycombed concrete or concrete over rusted reinforcing bars shall be removed and repaired with pneumatically placed mortar. The Engineer shall determine all areas to be repaired and the limits of repair at each area.
- 5- Cleaning - See Special Provisions
- 6- Control of traffic - See Special Provisions.