



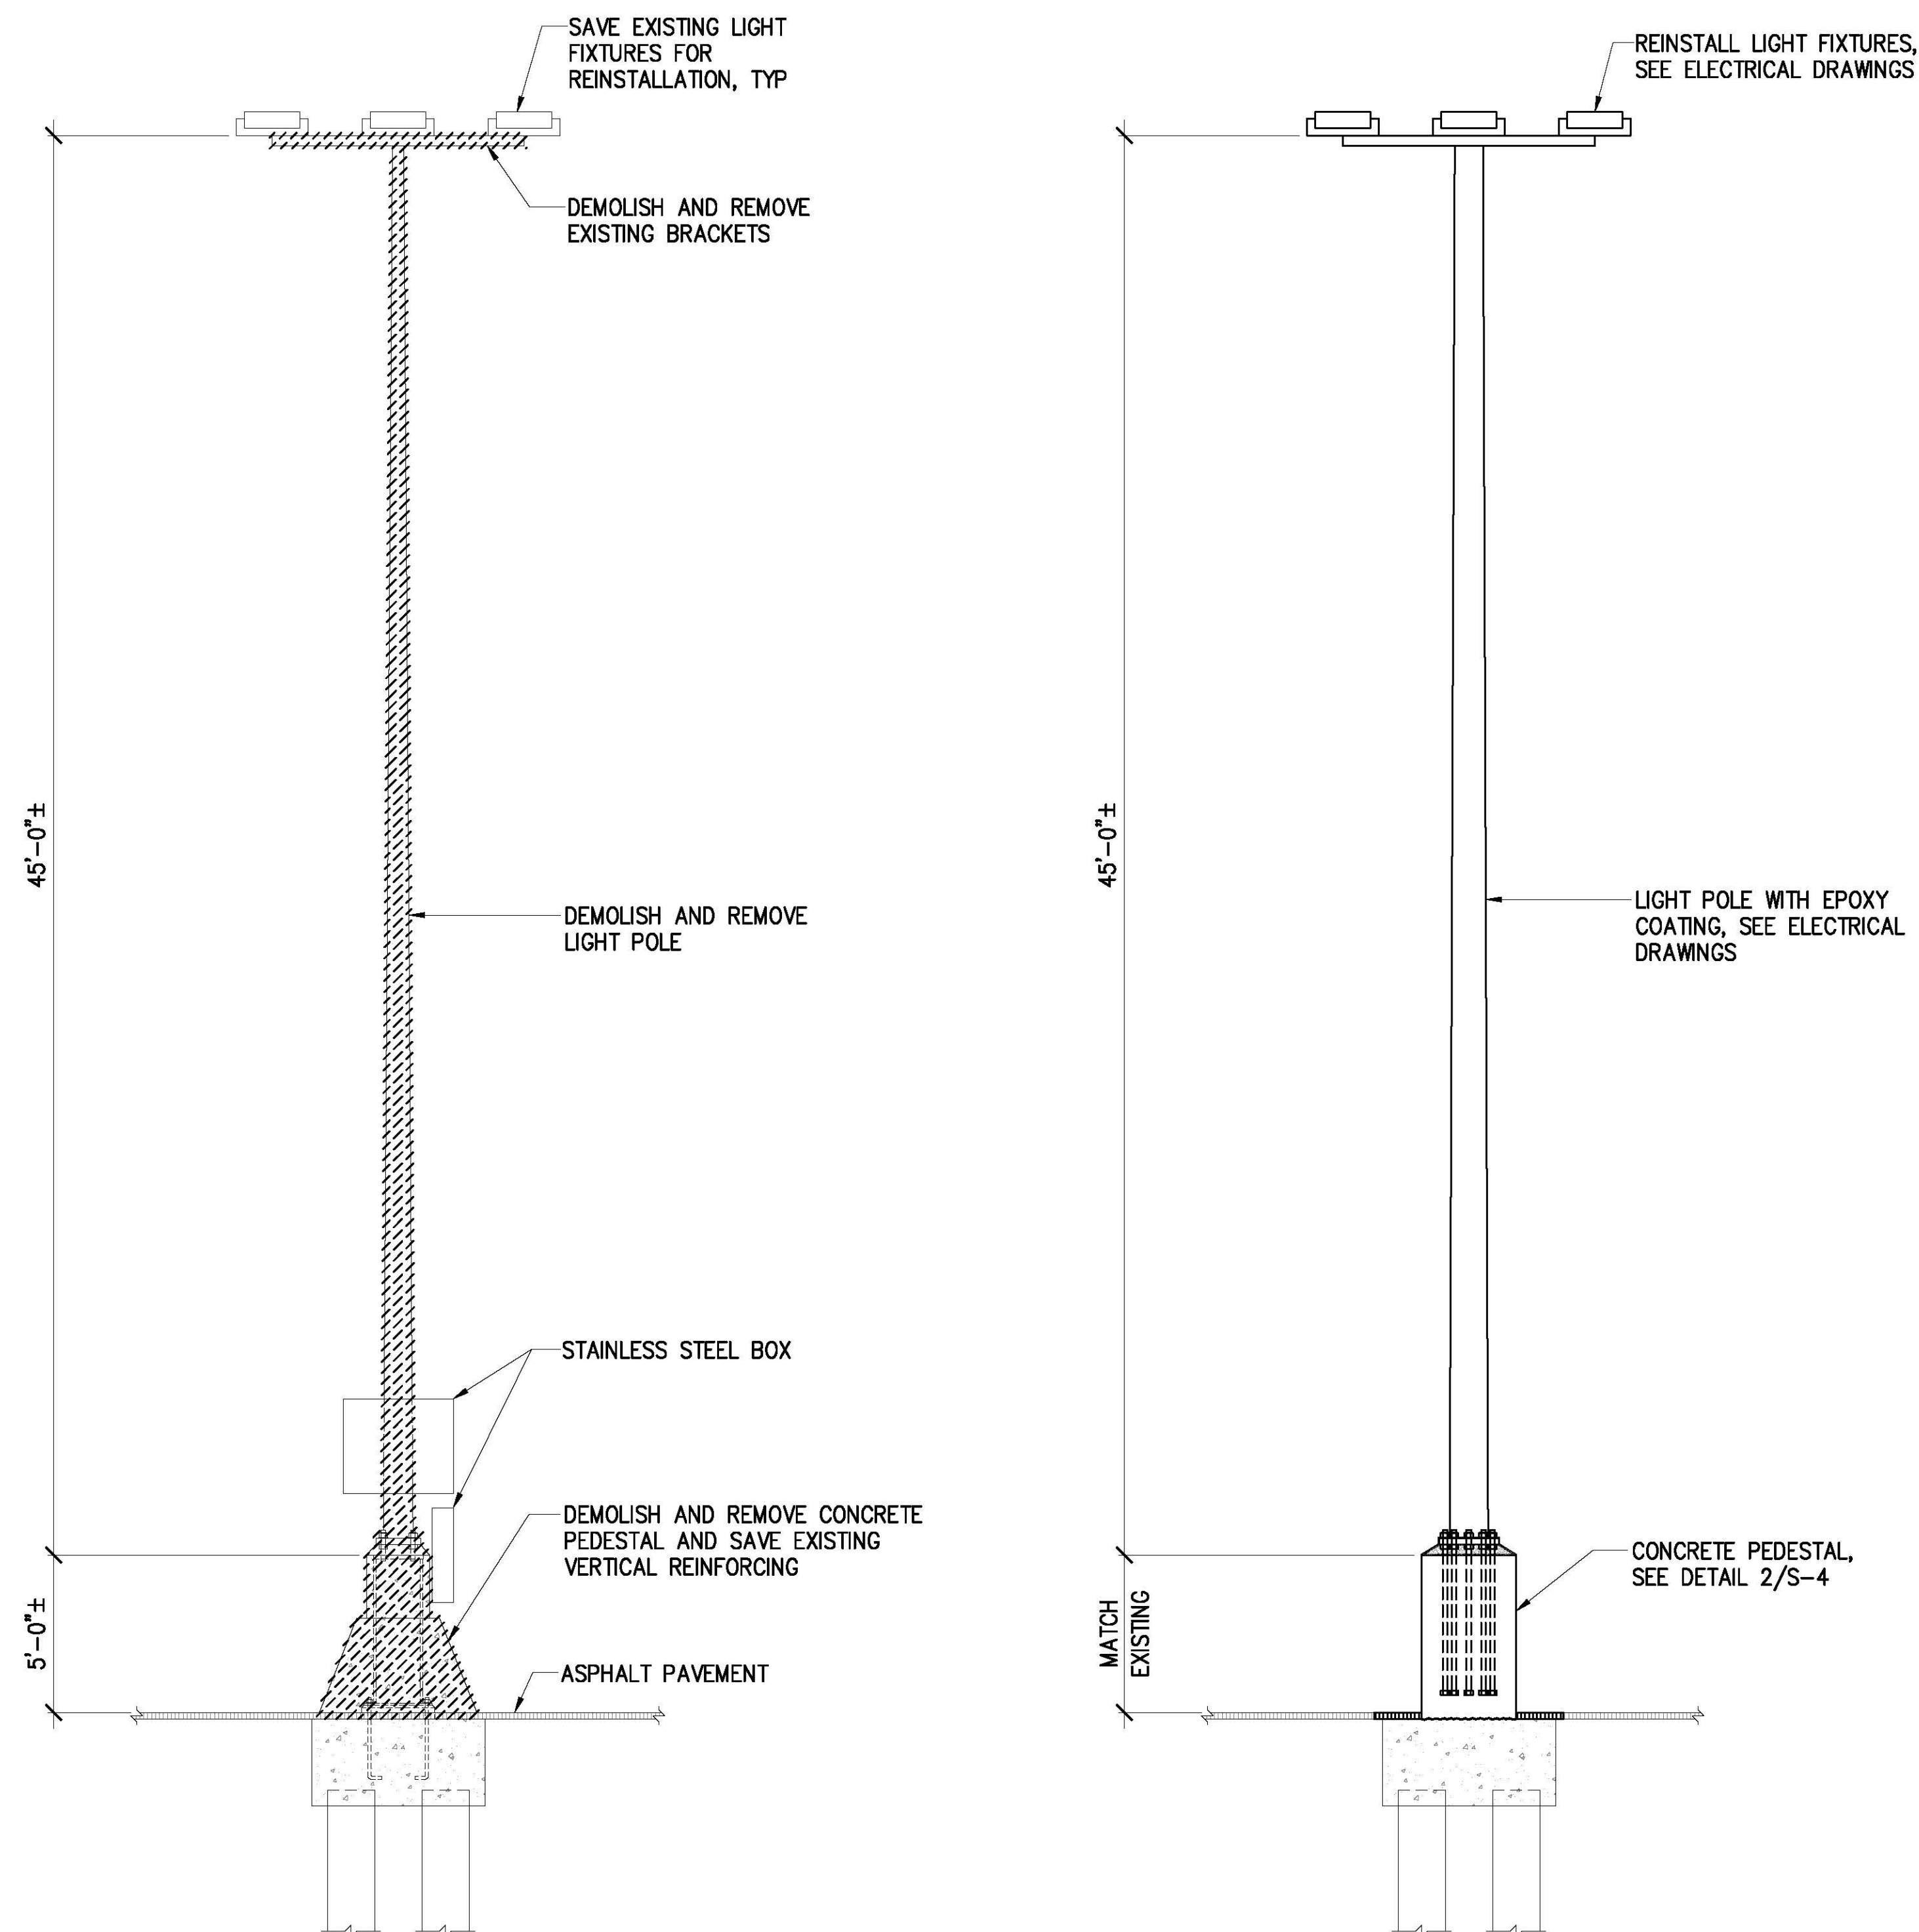

EXISTING CONDITION


REPAIRED CONDITION

1 LIGHT POLE 36 REPAIR
S-4 SCALE: 1/4" = 1'-0"

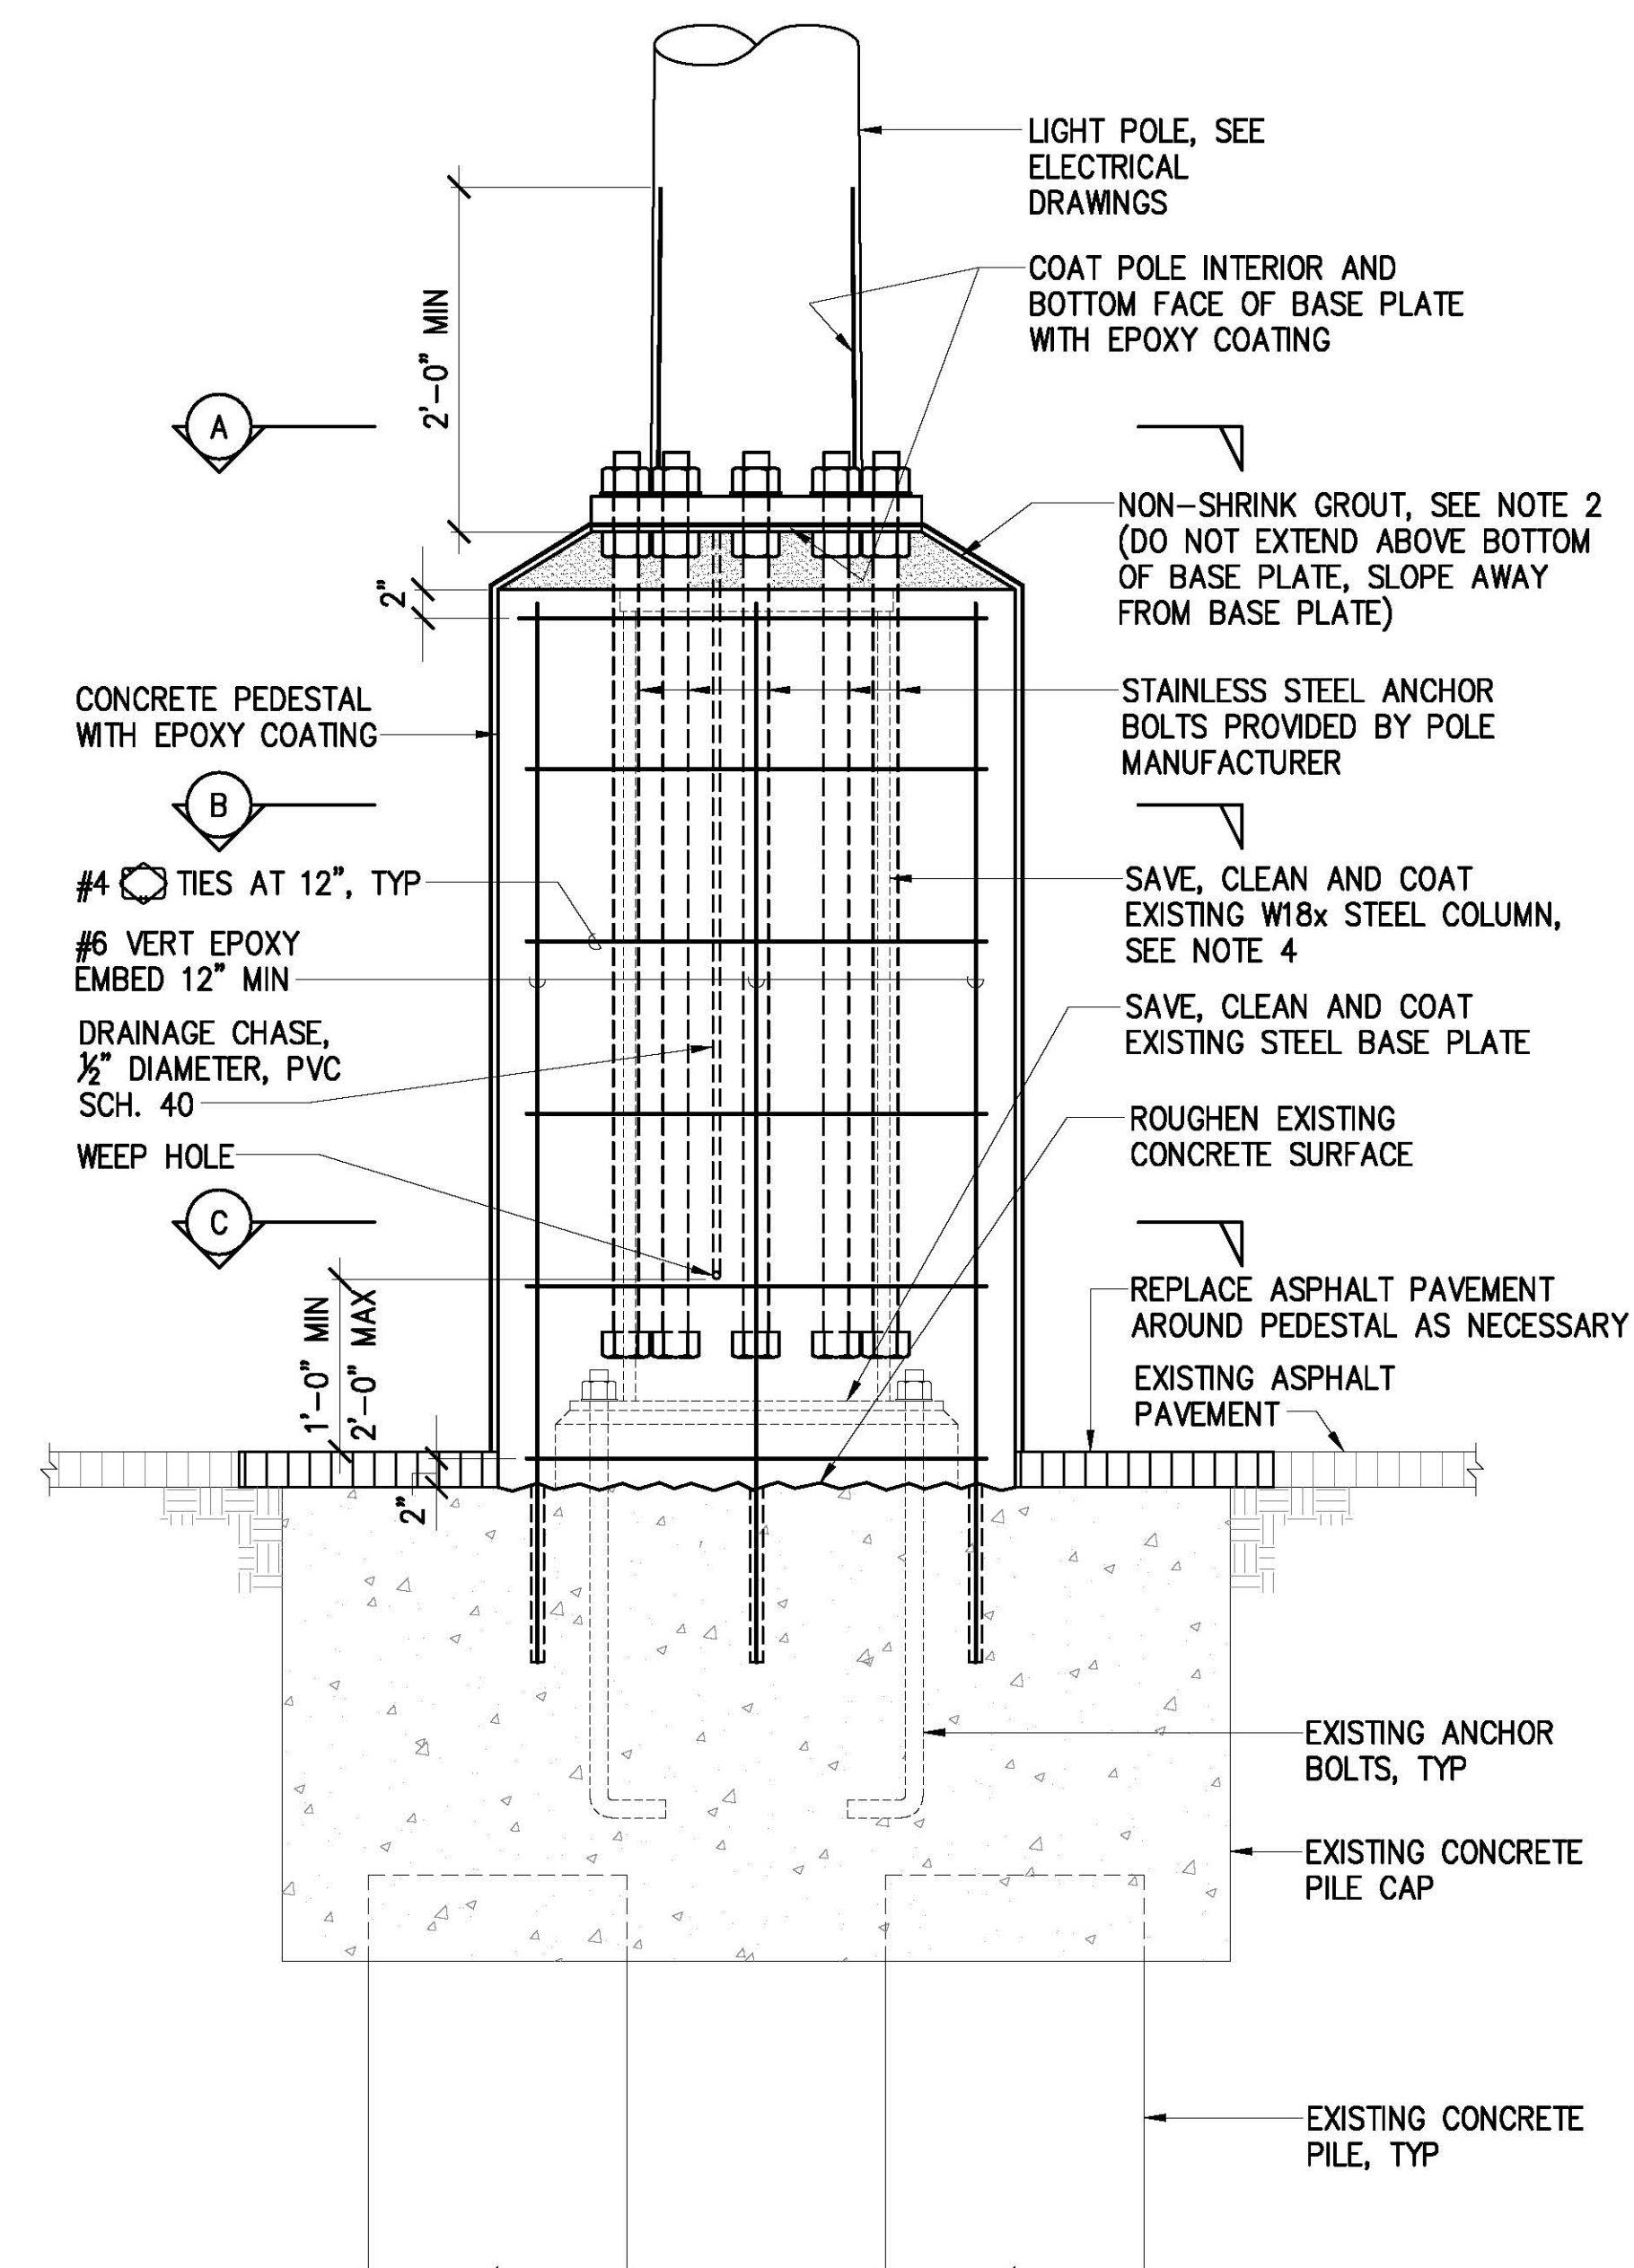


SECTION


2 PEDESTAL REPAIR (POLE 36)
S-4 SCALE: 1" = 1'-0"

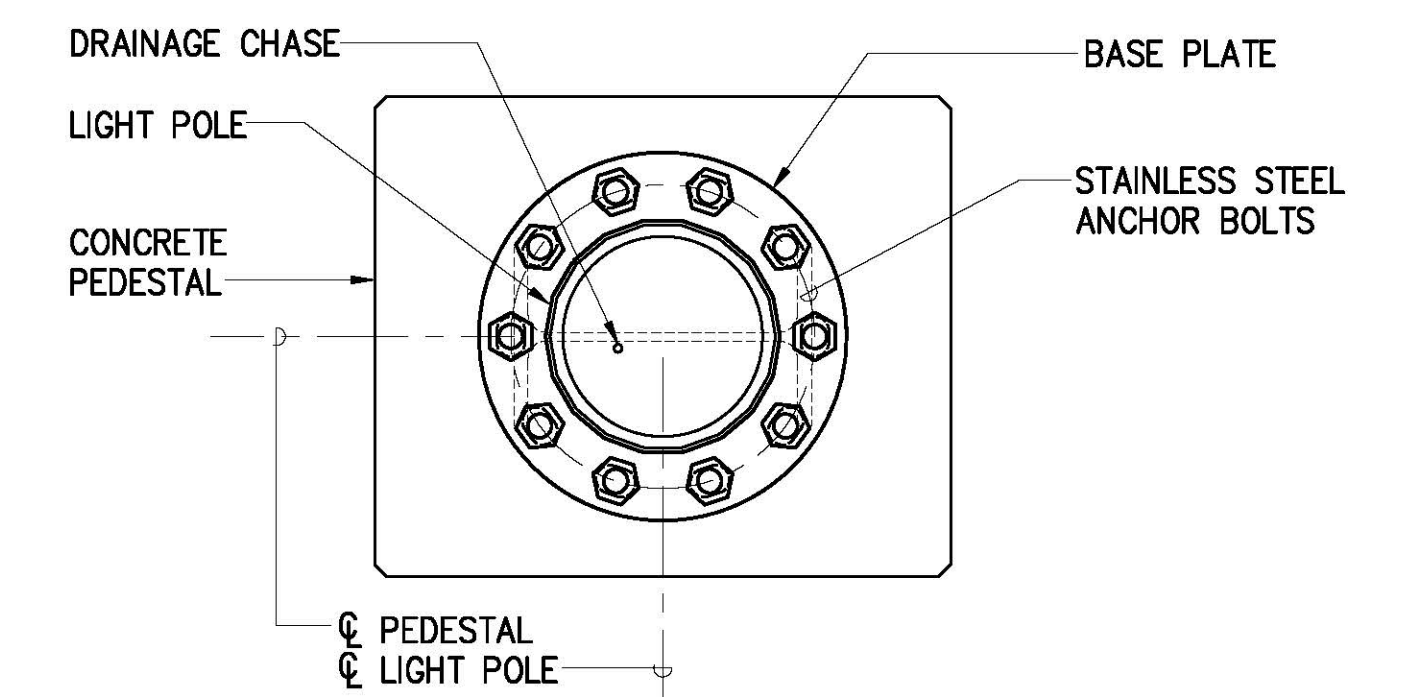

A SECTION

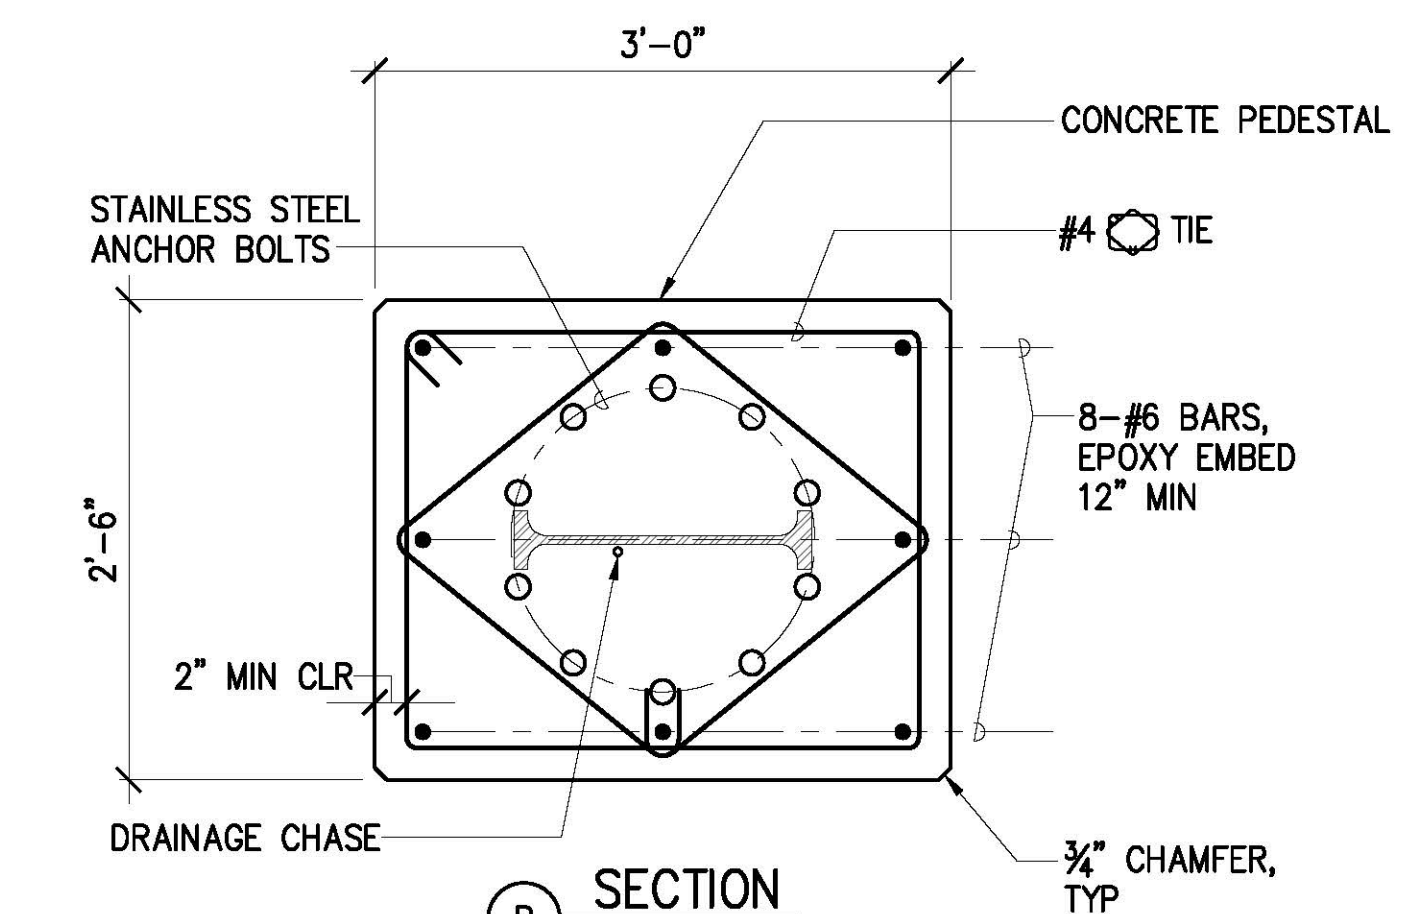

B SECTION

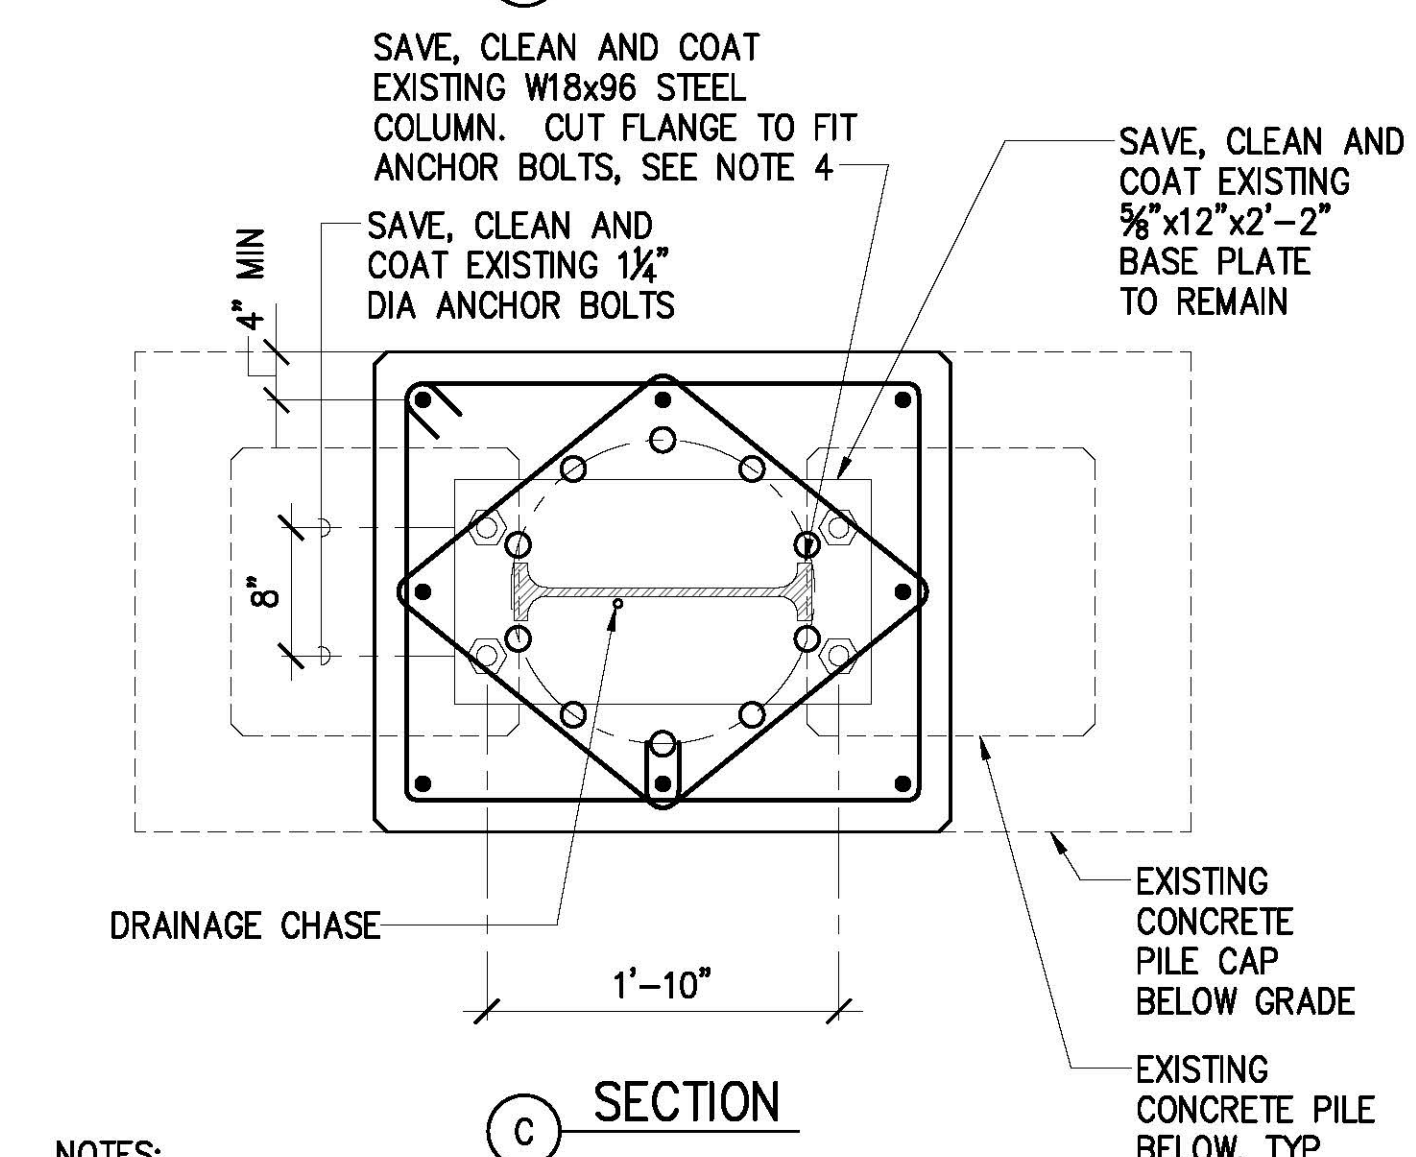

C SECTION

- NOTES:**
- MAXIMUM GROUT HEIGHT SHALL BE 3" MAX AND AS RECOMMENDED BY THE POLE MANUFACTURER.
 - SEE ELECTRICAL DRAWINGS FOR ELECTRICAL WORK INCLUDING CONDUITS, GROUNDING ROD, ETC.
 - SAVE, CLEAN AND COAT EXISTING VERTICAL PEDESTAL REINFORCING WITHIN NEW PEDESTAL.
 - EXISTING W18x FLANGES MAY BE CUT TO FIT ANCHOR BOLTS. SMALL PENETRATIONS < 4" DIA MAY BE MADE FOR ELECTRICAL WORK.



THIS WORK WAS PREPARED BY ME OR UNDER MY SUPERVISION
EXP. 4-30-24
MKE ASSOCIATES LLC

REVISION	DATE	DESCRIPTION	BY	APPROVED
STATE OF HAWAII DEPARTMENT OF TRANSPORTATION HARBORS DIVISION				
JOB TITLE REPAIR LIGHT POLES AND PEDESTALS AT PIER 1 HILO HARBOR, HAWAII				
SHEET TITLE LIGHT POLE REPAIR DETAILS - POLE 36				
DESIGNED BY: GO	JOB NUMBER S50201		SHEET S-4	
DRAWN BY: DL				
CHECKED BY: GM				
DATE: 04/2023				
SCALE: AS SHOWN	6 OF 19 SHTS.			